
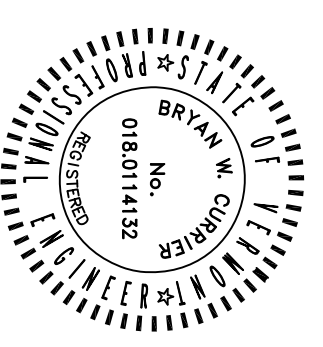


Storm Maintenance Identifiers

| Icon | Identifier | Inspection Frequency | Need to Check | Maintenance Triggers |
|------|---|----------------------|-----------------------------|--|
| 1 | OIL/GRIT SEPARATOR: | ANNUAL | NEED TO CHECK | MAINTENANCE TRIGGERS |
| 2 | STORMWATER PUMP: | MONTHLY | PUMP OVERALARM FLOATS | SYSTEM FAILURE |
| 3 | CATCH BASIN: | ANNUAL | SUMP DEPTH, BASIN INTEGRITY | 50% SUMP DEPTH, LARGE CRACKS INVERT UNDER WATER |
| 4 | STORM MANHOLE: | ANNUAL | SUMP DEPTH, BASIN INTEGRITY | 50% SUMP DEPTH, LARGE CRACKS INVERT UNDER WATER |
| 5 | UNDERGROUND STORAGE CHAMBERS: | ANNUAL | INSPECTION PORT | STANDING WATER, ACCUMULATION OF SEDIMENT ON ISOLATOR ROW X6 INCHES |
| 6 | STORM MANHOLE WITH FLOW CONTROL DEVICE: | ANNUAL | FLOW CONTROL DEVICE | REMOVE ANY MATERIAL CLOGGING ORIFICES |
| 7 | DECK DRAINS | ANNUAL | GRATE | REMOVE ANY MATERIAL CLOGGING GRATE |

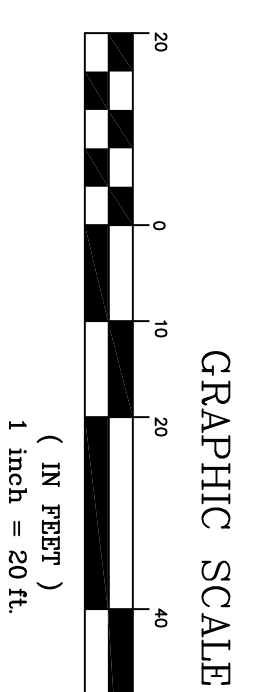

| | | |
|---|----------------|--|
| DATE | REVISION | BY |
| 01/14/19 | RECORD DRAWING | BT |
| 01/14/19 | FINAL | |
| 01/14/19 | PRELIMINARY | |
| 01/14/19 | SKETCH/COMMENT | |
| 01/14/19 | DESIGNED | |
| 01/14/19 | CHECKED | |
| 01/14/19 | SCALE | |
| O'LEARY-BURKE CIVIL ASSOCIATES, P.C. 13 CORPORATE SQUARE FARMINGDALE, NY 11737 TEL: 609-291-1111 FAX: 609-291-1112 EMAIL: oley@olearyburke.com | | |
| Hotel Champlain Burlington, Vermont | | DATE: 1-14-19 DRAWN: BTB CHECKED: BTB SCALE: AS SHOWN SHEET: 59 TOTAL SHEETS: 7 |
| Stormwater Maintenance Plan | | ST4 |